Systems approach in the inspection of suspension bridges

Autor(en): Rao, Ranganatha R. / Sanghvi, Sudhir

- Objekttyp: Article
- Zeitschrift: IABSE congress report = Rapport du congrès AIPC = IVBH Kongressbericht

Band (Jahr): 14 (1992)

PDF erstellt am: **12.07.2024**

Persistenter Link: https://doi.org/10.5169/seals-853241

Nutzungsbedingungen

Die ETH-Bibliothek ist Anbieterin der digitalisierten Zeitschriften. Sie besitzt keine Urheberrechte an den Inhalten der Zeitschriften. Die Rechte liegen in der Regel bei den Herausgebern. Die auf der Plattform e-periodica veröffentlichten Dokumente stehen für nicht-kommerzielle Zwecke in Lehre und Forschung sowie für die private Nutzung frei zur Verfügung. Einzelne Dateien oder Ausdrucke aus diesem Angebot können zusammen mit diesen Nutzungsbedingungen und den korrekten Herkunftsbezeichnungen weitergegeben werden.

Das Veröffentlichen von Bildern in Print- und Online-Publikationen ist nur mit vorheriger Genehmigung der Rechteinhaber erlaubt. Die systematische Speicherung von Teilen des elektronischen Angebots auf anderen Servern bedarf ebenfalls des schriftlichen Einverständnisses der Rechteinhaber.

Haftungsausschluss

Alle Angaben erfolgen ohne Gewähr für Vollständigkeit oder Richtigkeit. Es wird keine Haftung übernommen für Schäden durch die Verwendung von Informationen aus diesem Online-Angebot oder durch das Fehlen von Informationen. Dies gilt auch für Inhalte Dritter, die über dieses Angebot zugänglich sind.

Ein Dienst der *ETH-Bibliothek* ETH Zürich, Rämistrasse 101, 8092 Zürich, Schweiz, www.library.ethz.ch

http://www.e-periodica.ch



Systems Approach in the Inspection of Suspension Bridges

Approche globale de l'inspection des ponts suspendus

Gesamtplanung bei der Inspektion von Hängebrücken

Ranganatha R. RAO Associate Steinman Consulting Engineers New York, NY, USA



Manhattan Bridge, New York, USA 1.0 INTRODUCTION


In the early part of this century, a number of suspension bridges were built in the metropolitan arcas of the USA. These heavily traveled bridges are aging rapidly due to fatigue, corrosion and wear. While it is not practical to replace these bridges, especially in a megalopolis, these bridges can be salvaged by maintenance and rehabilitation through regular inspection that will keep them functioning for the demanding traffic needs of the next millennium. Hence methodical inspection and reporting has assumed paramount importance.

2.0 INSPECTION AS A PROCESS

A scientific and systematic approach for bridge inspection is outlined in figure 1. It is critical to 3.0 recognize inspection as a process and not as an isolated event that takes place on a periodic basis. By doing so, the need based attitude, which normally has short term applications only, can be traffic and 4 tracks of New York City transit trains. transformed to a wider spectrum that encompasses several short and long term applications. example, the quantitative elements allows tracking of their conditions over a uncompromising period of time so as to monitor the overall allotment of time for inspection and rehabilitation. condition of the bridge; inventory of bridge

Sudhir SANGHVI

Project Engineer Steinman Consulting Engineers New York, NY, USA

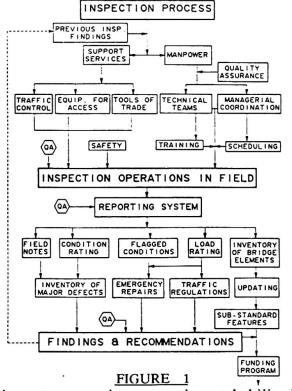

elements complements the rehabilitation expenditure planning, etc.

A case study of the recently completed biennial inspection of the Manhattan Bridge, New York, the above USA is presented below wherein principles were implemented.

CASE STUDY

Manhattan Bridge is a 90 year old bi-level suspension bridge carrying 7 lanes of vehicular The AADT (1988) was over 75,500 along with 960 For trains a day. This bridge, being one of the major condition rating of crossings serving the City of New York, requires traffic restrictions on the

The 1990 biennial inspection was performed

over a period of 4 months. The authors were in the team of 11 Registered Professional Engineers and 10 Structural Engineers. The inspection was conducted for the New York State and New York City Departments of Transportation.

As the train tracks are located on the outer portions of the bridge, the eccentric train loads penalize the stiffening trusses and floor systems with torsional effects. During the inspection more

than 1200 defects were recorded and 615 of them were flagged demanding immediate attention. Prompt corrective actions were taken by the New York City Department of Transportation in terms of performing emergency repairs, reviewing the load rating and temporarily closing of one lower roadway lane and two tracks of NYC transit, pending repairs. Some of the major defects are highlighted in the bridge cross-section in Figure 2

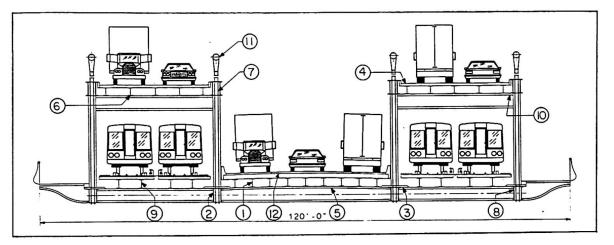


FIGURE 2: CROSS SECTION OF MANHATTAN BRIDGE, NEW YORK - Major Defects Reported

- 5. Corrosion of top flange 1. Cracks in stringers
- 6. Uplifted Stringer brg. 2. Corrosion
- 3. Cracked continuity 7. Suspender wear/
 - Striking top chord angle
- 8. Cracked chord splice 4. Deck defects

A system of collecting, preparing and representing a comprehensive database from the data collected in the field became a powerful tool for decision making on issues like traffic limiting, planning for rehabilitation, etc. This database included past and present condition ratings of various elements, listings of hazardous classified conditions demanding immediate action, respective actions etc. New York State Department taken. of Transportation has developed a system of quantitative rating of elements based on the residual capacity and functionality of the element instead of using terms like "Sound", "Fair". "Satisfactory", etc. On a scale of 7 (new condition) to 1 (hazardous condition), a rating of 3 denotes and not functioning "serious deterioration as originally designed." Usage of this system led to drastic reduction in the subjectivity of the rating between inspectors.

For the Manhattan Bridge, a database of defect conditions defects and flagged was prepared. It also included the condition ratings of over 30,000 elements of the bridge. Defects observed during the previous inspection were also impracticality of replacing them. reviewed and checked whether repaired or not.

- 9. Track Stringer Brg.- Displaced/cracked
- 10. Cracked floorbeam end
- 11. Corroded Cable Wrapping
- at lower saddle
- 12. Leaky deck joints

4.0 INSPECTION INFORMATION SYSTEM (IIS) With all the above information when organized and mapped, the contour of even rated elements revealed a pattern of deficiencies on the bridge. this information could not have Individually. revealed the complete picture. For example, the flagged condition would identify a serious defect, but would not present any information about adjoining members, without which the overall condition of the bridge could not be visualized. In one particular instance, the owners of the Manhattan Bridge decided to close one lane of vehicular traffic after observing a concentration of low ratings on the floor system of the lower It was this systematic roadway. and logical approach that eased the process of decision making.

5.0 CONCLUSION

The potential of IIS is multifarious. It can act not only as a management tool to attend to immediate needs, but also can improve forecasting and the process of selective rehabilitation to match the available funding. IIS will become more and more valuable, particularly in metro areas, as the existing older bridges will gain more prominence due to the